

TECH TIPS

IGNITION COILS



REFS. 155043 & 156800 | ASSEMBLY EVOLUTION

The **156800** coil matches with the OEM **597012** and **597056**. It is fitted to PSA vehicles **with a model year between May 1996 and December 2000** (older vehicles type 106 II S16 TU5J4). This coil has a **connector with 2 grooves**.




Connector with
2 coded pins

Ref. : **156800**

Primary winding resistance : 0,55 Ω
Secondary winding resistance : 12,8 K Ω

For more recent vehicle models **(from January 2001 to July 2003)**, the manufacturer has developed another coil: 155043, which has a connector **with 3 grooves - an additional coding device which means that this new coil cannot be fitted to older vehicles**. This coil corresponds to the following OEM part numbers: **5970A3** and **597081**.

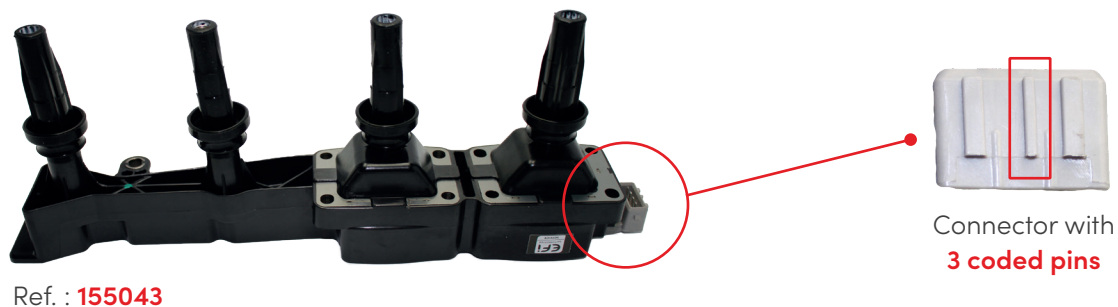

Ref. : **155043**

Primary winding resistance: approximately 0,5/1 Ω
Secondary winding resistance: 11,3 K Ω

Be careful not to confuse the two coils, as they are not interchangeable! The grooves on the connector make it impossible to confuse them.

***Indicative dates:** variations by engine.



Technical hotline

+33 (0)4 72 88 12 63

hotline.aftermarket@efiautomotive.com